



WOOD FINISHES DIRECT

The following Product Datasheet is provided by **Woca**

Wood Finishes Direct cannot be held liable for the information contained within this document.

For purchasing information visit:
[Woca Maintenance Gel](#)



1 PREPARE 2 TREAT 3 MAINTAIN

MAINTENANCE GEL

PRODUCT DESCRIPTION

Maintenance Gel is for the care and maintenance of oiled indoor wooden surfaces and floors. The oil is quick-drying and leaves an attractive, water and dirt-repellent surface. Maintenance Gel is suitable for furniture, kitchen work surfaces, floors and other indoor wooden surfaces. It can also be used for improved results on factory-oiled/UV-oiled surfaces.


APPLICATION AREA

For care and maintenance of all oiled wood types. Only for indoor use.



Easy to apply

Application and polishing can be done by hand with a hand scrubber. Non-drip. Minimal product spillage.

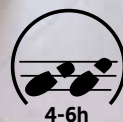

Quick-drying

Light use: 4-6 hours
Fully hard: 2-3 days



Ideal for UV-oil

Especially suitable for revitalization and maintenance of UV-oiled/factory-oiled wood furniture, worktops and floors.



Easy to maintain

No special tool required. Just use the standard WOCA-system.

Product information

Coverage:

Regular maintenance: 20-30 m²/200 ml

Newly-sanded/non-maintained wood: 20-30 m²/L

Packaging: 200 ml

Colours: Natural, White, Extra White & Walnut





WORK DESCRIPTION

Preparation

It is important that both wood and oil are at a temperature of at least 15°C, and ideally about 20°C, and that air humidity is approx. 50 %. Make sure that the room is well-ventilated, for optimal evaporation and drying time.

Thoroughly clean the surface with Intensive Wood Cleaner, mixed 1 part cleaner to 20 parts water. Then wash with clean water. After cleaning, leave the surface to dry for at least 8 hours, at 20°C.

Risk of self-ignition!


Any cloths that are soaked in gel should be stored/disposed of in sealed containers or incinerated due to risk of self-ignition.

Please note


The oiled surface should not be exposed to water for the first 2-3 days when the gel is hardening, as this can cause stains and discolouration.

Maintenance

Weekly cleaning: Natural Soap
Monthly care: Oil Refreshing Soap

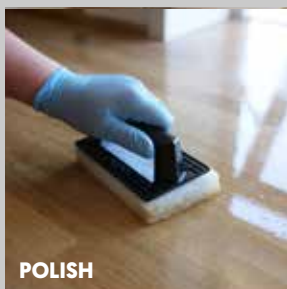

POLISH

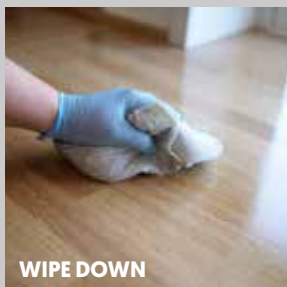

WIPE DOWN

TREATMENT

- 1 Apply an appropriate amount of gel to a red/white WOCA Hand Scrubber and distribute over the surface in a thin, even coat. Continue polishing until the wood seems saturated and the surface has a uniform appearance.

It is recommended to work on small areas at a time, as the gel is quick/drying. For larger areas (floors larger than 10 m²) it would be advantageous to use a polishing machine.

- 2 Immediately wipe down the polished surface with a clean, dry lint-free cotton cloth. When prepping with a machine, the final polishing should be done with a cotton cloth beneath the buffer. The surface should not appear wet and no excess gel should remain on the surface.
- 3 If the wood does not seem fully saturated after 4-6 hours, it would be advantageous to repolish, with less gel than the first treatment, but following the same procedure.

Wait 4-6 hours before using the surface. Avoid getting water or dirt on the wooden surface for the next 2-3 days.