



WOOD FINISHES DIRECT

The following Product Datasheet is provided by **Woca**

Wood Finishes Direct cannot be held liable for the information contained within this document.

For purchasing information visit:
[Woca Worktop Oil](#)



1 PREPARE 2 TREAT 3 MAINTAIN

WORKTOP OIL

PRODUCT DESCRIPTION

Worktop Oil is an air-hardening oil that penetrates deep into the wood, leaving a tough water- and stain-resistant surface. The oil highlights the wood's natural glow and gives the surface a natural, fresh appearance. Worktop Oil can be used on surfaces that are untreated or that have previously been oil-treated/sanded.

APPLICATION AREA

For the care and maintenance of untreated or previously oil-treated/sanded surfaces. Only for indoor use.

Product information

Coverage: 12-15 m²/L

Packaging: 0.75 L

Colours: Natural, white, grey & black



High resistance

Penetrates deep into the wood. Ensures maximum dirt and water resistance from day one.



Natural appearance

Emphasizes the natural grain for a more attractive look. Ideal for all types of wood.




Easy polishing

The oil is smooth and pleasant to work with. Polishing can be done by hand with a hand scrubber.



Easy to maintain

Can be cleaned and maintained with WOCA soap and gel for oiled indoor surfaces.

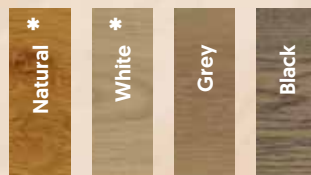



WORK DESCRIPTION

Preparation

It is important that both wood and oil have a temperature of min. 15°C (preferably around 20°C) and air humidity of approx. 50 %. Make sure that the room is well-ventilated for optimal evaporation and drying time.



Sand the untreated surface with grit 180. Vacuum clean the surface to remove sanding residue. Thoroughly clean the surface with Intensive Wood Cleaner, mixed 1 part cleaner to 20 parts water. Then wash with clean water. After cleaning, leave the surface to dry for at least 8 hours at 20°C.

Drying time

The oiled surface can be used after 24 hours at 20°C. During this period, the surface must not come into contact with water. The oil does not harden completely until after about a week. Therefore, treat with care during this period. Any spilled liquids should be wiped up immediately.

Maintenance and cleaning

Weekly cleaning: Natural Soap or Natural Soap, spray
Monthly care: Oil Refreshing Soap
Maintenance: Worktop Oil or Maintenance Gel

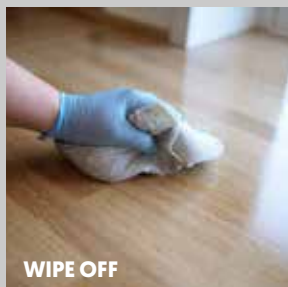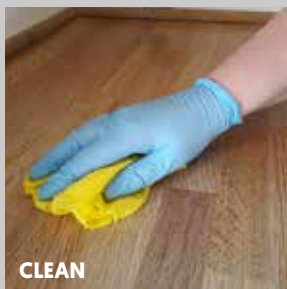

TREATMENT

- 1 Mix the oil thoroughly.
- 2 Use a paintbrush to distribute an appropriate amount of oil in an even, covering coat. If possible, the reverse side of the work surface should also be given a coat of oil.
- 3 Wait approx. 30 minutes at 20°C, while the oil soaks into the wood. Apply more oil if dry areas appear.
- 4 Polish with the red or white WOCA hand scrubber along the direction of the wood grain. This will make the surface more durable.
- 5 Then wipe off all excess oil with a lint-free cotton cloth. No excess oil should remain on the surface.
- 6 Allow the surface to rest for an hour and repeat steps. The surface should be treated two or three times before use. For the final treatment, sand in wet oil with grit 280-400 wet sandpaper, before wiping off with a lint-free cotton cloth.